




Subject: **3M™ Protecta® Cabloc™ Traveller damage assessment**

Region:	<b>EMEA</b>	Language:	<b>EN</b>	Number:	<b>PB0031</b>	Revision:	<b>01</b>
Total Pages:	1	First Issue:	<b>17/08/2022</b>	Rev. Date:	<b>17/08/2022</b>		

Dear Installer,

As part of the continuous improvement of our 3M™ DBI Protecta® Cabloc™ system, the present technical bulletin serves as an advisory note for the following:

- It has been reported that the shock absorber inner body of the system related travelers (6180200/6180201) can be deformed in specific conditions outside its normal use.

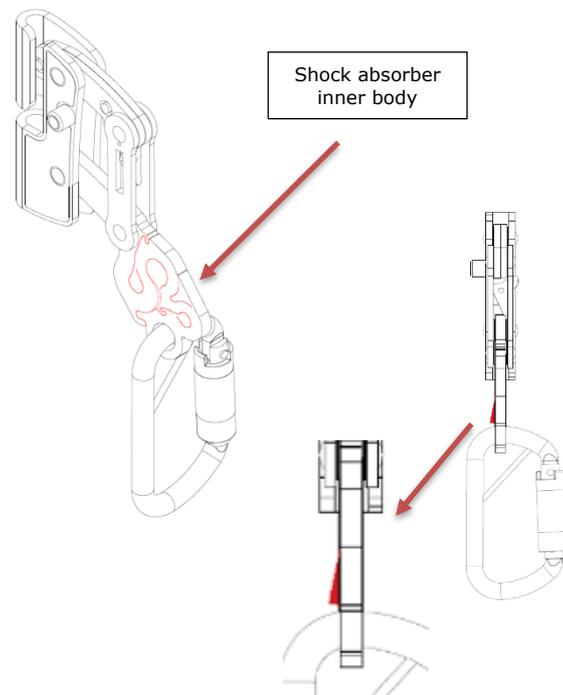

If the above happens, 3M™ advice is the following:

- If the deformation is equal or less than 50% of the overall thickness of the shock absorber body, we accept it's within the allowable deformation margin, and the advice is to leave it and DO NOT push it back to the original form.
- For deformations of more than 50% please suspend the use of the traveler and get in touch through your local representative or contact our customer services.



**Registered Offices:**